

WJE

Wiss, Janney, Elstner Associates, Inc.  
330 Pfingsten Road, Northbrook, Illinois 60062

MADE BY

JMT

SHEET NUMBER

SK-1

Garvin Central School

CHECKED BY

PROJ. NUMBER

Module A, Truss 7, Member 10-12 Repair


DATE

12/29/08

2004.2264

New K3/3 Repair. Install Prior To S3 Repair


New S3 Repair. Install Over New K3/3 Repair AT Joint 12. Install 3/4" Plywood Shims Along Bottom Chord In Area Outside of New Busset Repair

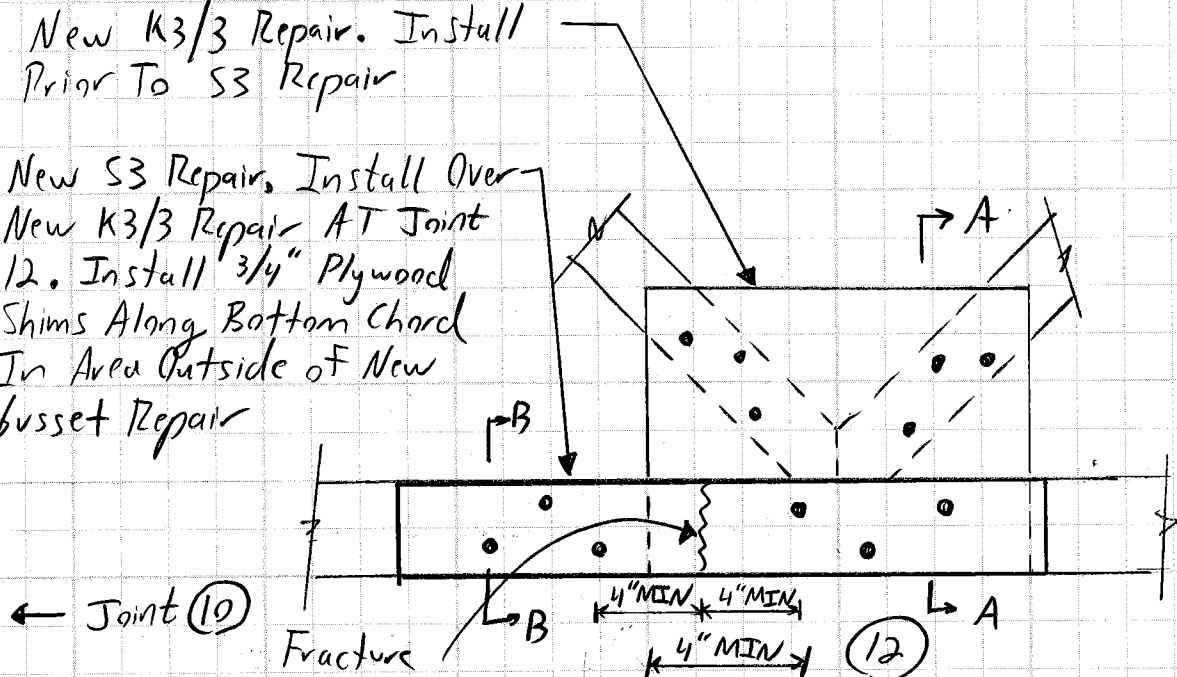

\* Note: Follow Typical Details Shown on Details 1 + 4 / Sheet 5-5 of "Building Corrective Work" Plans Submitted For Construction 10/31/05.

MODULE A, TRUSS 7 (TYPE H10-H19) K/S REPAIR

NOT TO SCALE

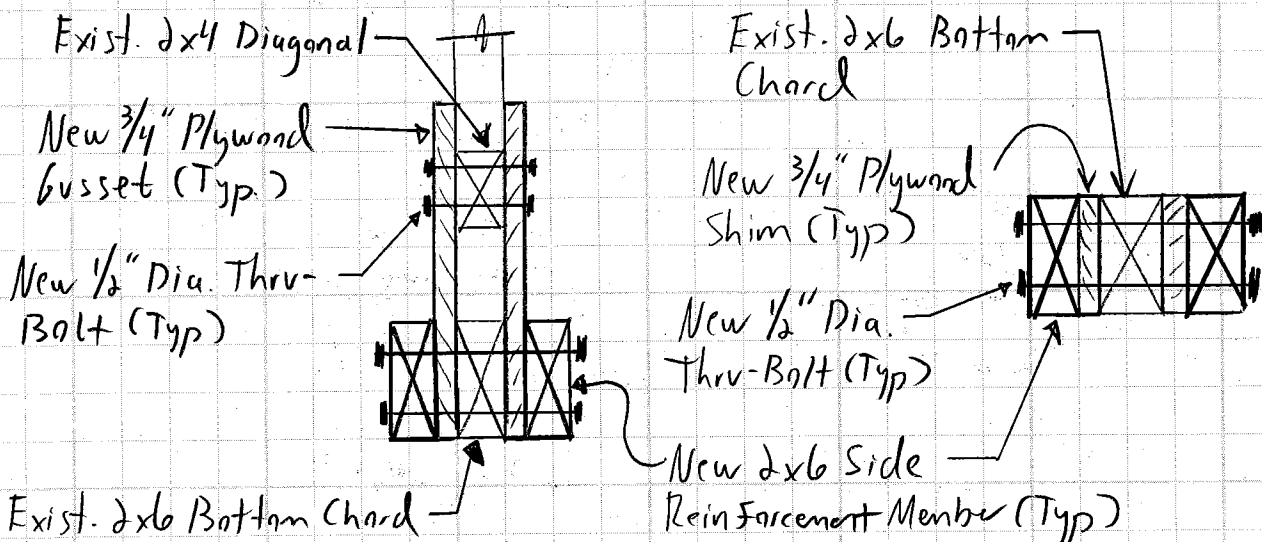

SECTION A-A

SECTION B-B

WJE

Wiss, Janney, Elstner Associates, Inc.  
330 Pfingsten Road, Northbrook, Illinois 60062

MADE BY

JMT

SHEET NUMBER

SK-2

CHECKED BY

PROJ. NUMBER


DATE

12/29/08

0004.2264

Garvin Central School


Module A, Truss 80, Member 6-8 Repair

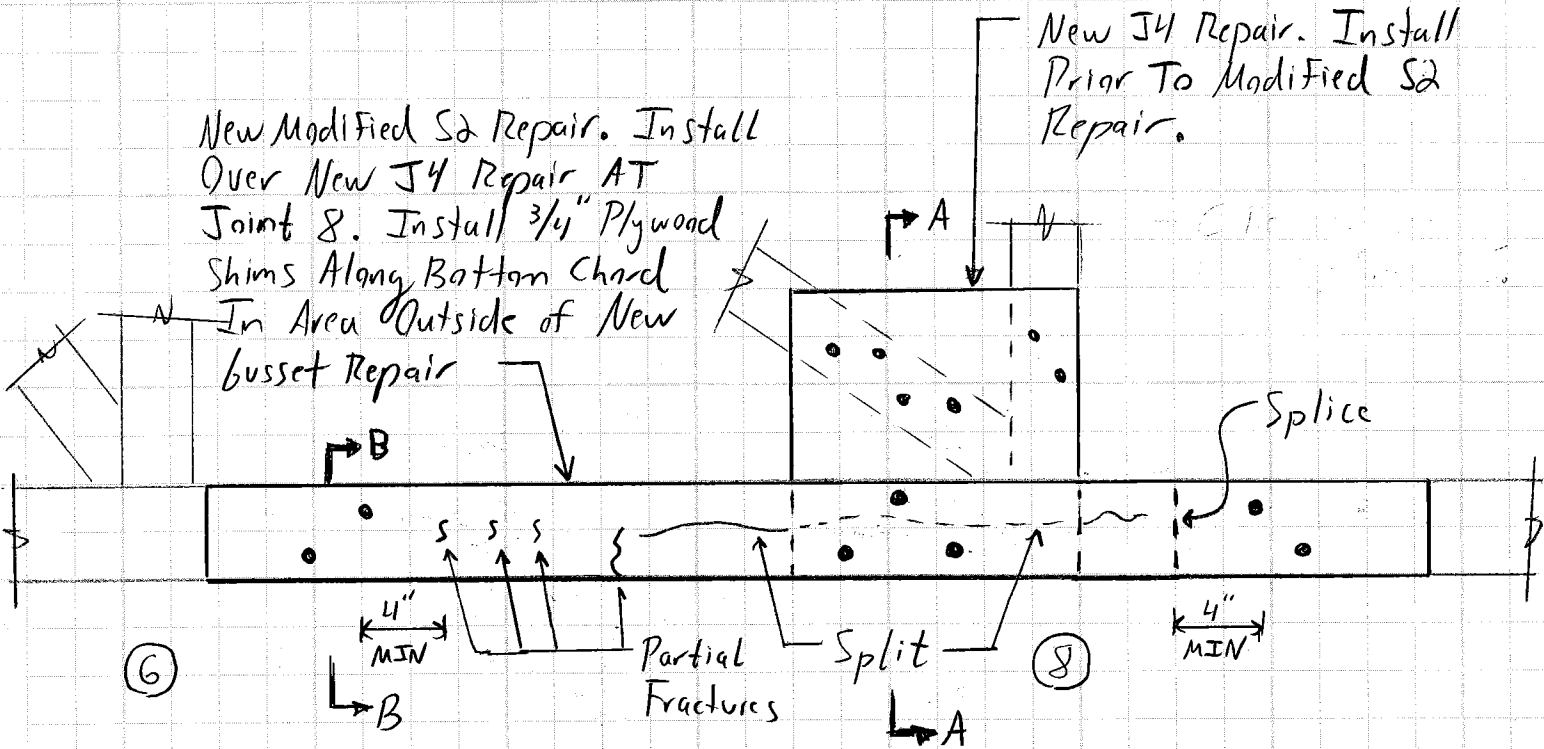

\* Note: Follow Typical Details Shown on Details 1 + 2 / Sheet S-5 of "Building Corrective Work" Plans Submitted for Construction 10/31/05.

MODULE A, TRUSS 80 (TYPE T1) J/S REPAIR

Not To Scale

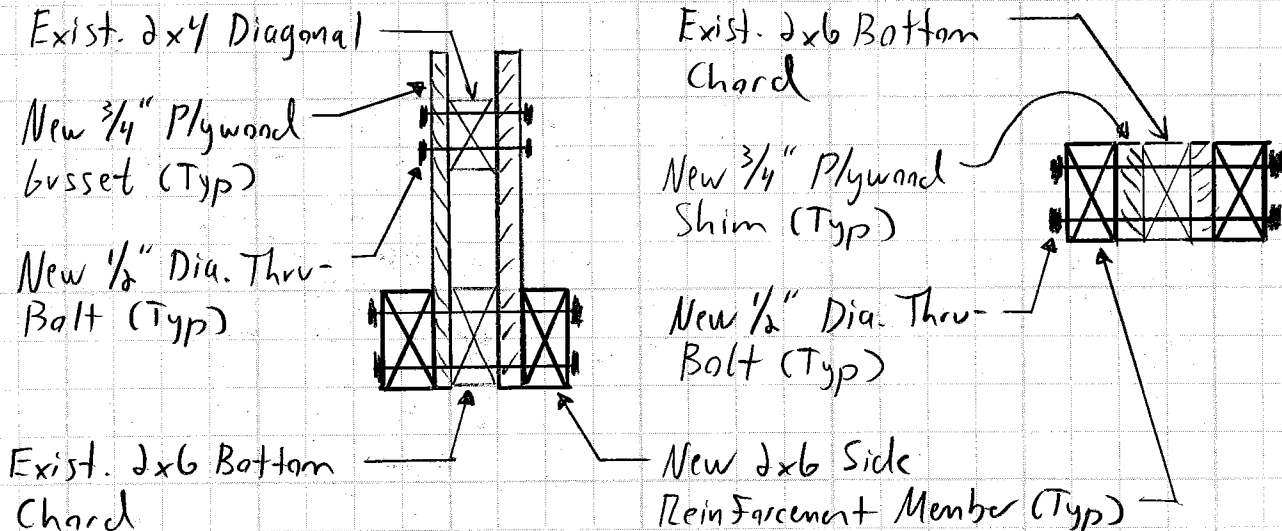

SECTION A-A

SECTION B-B